


Inclination sensor INX360D-F99-I2E2-V15

- E1-Type approval
- Measuring range 0 ... 360°
- Analog output 4 mA ... 20 mA
- Evaluation limits can be taught-in
- 2 programmable switch outputs
- High shock resistance
- Increased noise immunity 100 V/m

Dimensions

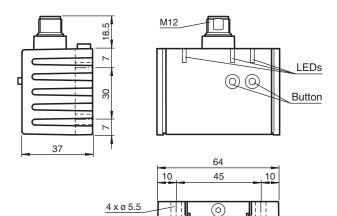

Π

65

Technical Data

G	aeneral	specifications	

Туре	Inclination sensor, 1-axis
Measurement range	0360 °
Absolute accuracy	≤±0.5 °
Response delay	≤ 20 ms
Resolution	≤ 0.1 °
Repeat accuracy	≤±0.1 °
Temperature influence	≤ 0.027 °/K
Functional safety related parameters	

Refer to "General Notes Relating to Pepperl+Fuchs Product Information"

Pepperl+Fuchs Group www.pepperl-fuchs.com USA: +1 330 486 0001 fa-info@us.pepperl-fuchs.com

Germany: +49 621 776 1111 fa-info@de.pepperl-fuchs.com Singapore: +65 6779 9091 fa-info@sg.pepperl-fuchs.com



INX360D-F99-I2E2-V15

Technical Data		
MTTF _d		300 a
Mission Time (T _M)		20 a
Diagnostic Coverage (DC)		0 %
ndicators/operating means		
Operation indicator		LED, green
Teach-In indicator		2 LEDs yellow (switching status), flashing
Button		2 push-buttons (Switch points programming, Evaluation range programming)
Switching state		2 yellow LEDs: Switching status (each output)
Electrical specifications		
Operating voltage	U_B	10 30 V DC
No-load supply current	I ₀	≤ 25 mA
Time delay before availability	t _v	≤ 200 ms
Switching output		
Output type		2 switch outputs PNP, NO , reverse polarity protected , short-circuit protected
Operating current	IL.	≤ 100 mA
Voltage drop		≤3 V
Analog output		
Output type		1 current output 4 20 mA
Load resistor		0 200 Ω at $U_B = 10 18 V$ 0 500 Ω at $U_B = 18 30 V$
Compliance with standards and directives		
Standard conformity		
Shock and impact resistance		100 g according to DIN EN 60068-2-27
Standards		EN 60947-5-2:2007 IEC 60947-5-2:2007
Approvals and certificates		
UL approval		cULus Listed, Class 2 Power Source
CCC approval		CCC approval / marking not required for products rated ≤36 V
E1 Type approval		10R-04
Ambient conditions		
Ambient temperature		-40 85 °C (-40 185 °F)
Storage temperature		-40 85 °C (-40 185 °F)
Mechanical specifications		
Connection type		5-pin, M12 x 1 connector
Housing material		PA
Degree of protection		IP68 / IP69K
Mass		240 g
Factory settings		u de la companya de la
Switching output 1		-30 ° 30 °
		-00 00
Switching output 2		-30 ° 30 °

 Refer to "General Notes Relating to Pepperl+Fuchs Product Information".


 Pepperl+Fuchs Group
 USA: +1 330 486 0001
 Get

 www.pepperl-fuchs.com
 fa-info@us.pepperl-fuchs.com
 fa-info@us.pepperl-fuchs.com

INX360D-F99-I2E2-V15

Connection

Standard symbol/Connection:



Connection Assignment



Wire colors in accordance with EN 60947-5-2

1	BN	(brown)
2	WH	(white)
3	BU	(blue)
4	BK	(black)
5	GY	(gray)

Accessories

V15-G-2M-PUR

Female cordset, M12, 5-pin, PUR cable


Refer to "General Notes Relating to Pepperl+Fuchs Product Information"

Mounting

Sensor Orientation

In the default setting the zero position of the sensor is reached, when the electrical connection faces straight upwards.


X Orientation

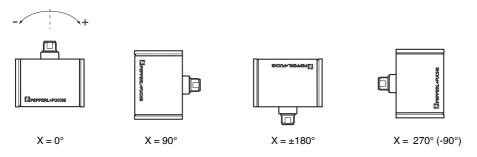

Mounting of the sensor

Sensors from the -F99 series consist of a sensor module and accompanying cast aluminum housing. Select a vertical surface with minimum dimensions of 70 mm x 50 mm to mount the sensor.

Mount the sensor as follows:

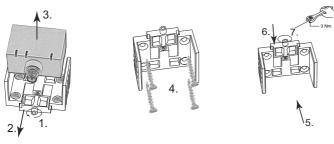

- 1. Loosen the central screw under the sensor connection.
- 2. Slide back the clamping element until you are able to remove the sensor module from the housing.
- 3. Remove the sensor module from the housing
- 4. Position the housing at the required mounting location and secure using four countersunk screws. Make sure that the heads of the screws do not protrude.
- 5. Place the sensor module in the housing.
- 6. Slide the clamping element flush into the housing. Check that the sensor element is seated correctly.
- 7. Finally tighten the central screw.

The sensor is now mounted correctly.

Additional Information

LED display

Displays dependent on the operating state	LED	LED	LED
	green:	yellow	yellow
	Power	out 1	out 2
Teach-in of switching points (output S1):	off	flashes	off
Teach-in of switching points (output S2):	off	off	flashes
Activate teach-in mode for analog limits:	off	flashes	flashes
Teach-in of analog limits	off	flashes	off
Normal operation	on	switchings	switchings
		tate	tate
Reset to factory settings:			
2 s 10 s	off	flashes	flashes
> 10 s end of reset process	flashes	off	off
Followed by normal operation			
Undervoltage	flashes	off	off

Refer to "General Notes Relating to Pepperl+Fuchs Product Information"

Inclination sensor

Axis definition

The definition of the X-axis is shown on the sensor housing by means of an imprinted and labeled double arrow. The figure shows the clockwise direction of rotation.

Teach-in of switching points (output S1)

- 1. Press key T1 > 2 s (see LED display)
- 2. Move sensor to switching position 1
- 3. Press key T1 briefly. LED "out 1" lights for 1.5 s as confirmation. Switching point 1 has been taught
- 4. Move sensor to switching position 2
- 5. Press key T1 briefly. LED "out 1" lights for 1.5 s as confirmation. Switching point 2 has been taught
- 6. Sensor returns to normal operation (see LED display)
 - The NC (active output state) is always defined in the range from the 1st configured position to 2nd configured position.



As an example : Case #1: configure position #1 at +45degree, configure position #2 at +90 degree; NC is from +45 ' +90 in the CW direction Case #2: configure position #1 at +90degree ; configure position #2 at +45 degree; NC is from +90 ' +45 in the CW direction

Teach-in of switching points (output S2)

Similar to the process for "Teach-in of switching points (output S1)", but with key T2 instead of key T1.

Teach-in of analog limits

- 1. Activate the teach-in mode for the analog limits by simultaneously pressing keys T1 and T2 until the green LED is extinguished and the two yellow LEDs flash. Then release the keys.
- 2. Press key T1 > for 2 s (see LED display)
- 3. Move the sensor into the position of minimum evaluation limit
- 4. Press key T1 briefly. LED "out 1" lights for 1.5 s as confirmation. The minimum evaluation limit has been taught. In this position the analog output will provide its minimum output value.
- 5. Move the sensor into the position of maximum evaluation limit
- 6. Press key T1 briefly. LED "out 1" lights for 1.5 s as confirmation. The maximum evaluation limit has been taught. In this position the analog output will provide its maximum output value.
- 7. Sensor returns to normal operation (see LED display)
 - If the sensor inclination exceeds one of the analog limits, the last value of the analog output is retained.

Resetting the sensor to factory settings

- 1. Press keys T1 and T2 > 10 s (see LED display)
- 2. The sensor has been reset when the green LED "Power" lights again after approx. 10 s.


Undervoltage detection

If the supply voltage falls below a value of approx. 7 V, all outputs and yellow LEDs are deactivated. The green "power" LED flashes rapidly. If the supply voltage falls below a value of approx. 8 V, the sensor continues with normal operation.

Technical Features

EMC Properties

Interference immunity in accordance with DIN ISO 11452-2: 100 V/m Frequency band 20 MHz up to 2 GHz Mains-borne interference in accordance with ISO 7637-2:

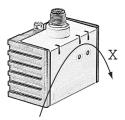

INX360D-F99-I2E2-V15

Inclination sensor

INX360D-	F99-I2E2	2-V15
----------	----------	-------

Pulse	1	2 a	2 b	3 a	3 b	4
Severity level	 	 	 	 	 	
Failure criterion	С	A	С	A	A	С
EN 61000- 4-2:	CD:8kV /			AD: 15 kV		
Severity level	IV			IV		
EN 61000- 4-3:	30 V/m (802500 MHz)					
Severity level	IV					
EN 61000- 4-4:	2 kV					
Severity level	III					
EN 61000- 4-6:	10 V (0.0180 MHz)					
Severity level	III					
EN 55011:	Klas	se A				

 Refer to "General Notes Relating to Pepperl+Fuchs Product Information".

 Pepperl+Fuchs Group
 USA: +1 330 486 0001
 Germany: +49 621 776 1111

 www.pepperl-fuchs.com
 fa-info@us.pepperl-fuchs.com
 Germany: +49 621 776 1111

