
# Features and Benefits

- Magnetic technology offers robust performance.
- 100% Non-contacting design (no bearings or bushing) provides an extremely long life expectancy and is tolerant to harsh environments.
- Simple two piece design (target magnet + encoder) for easy alignment and installation.
- Bi-directional two channel incremental quadrature output.
- Mounting holes for a 2-bolt or 3-bolt pattern 1.811 inch B.C. x 0.125 inch O.D.
- Target magnet for standard shaft sizes from 2 mm to 1/2 inch. Custom bore size available.
- Options up to 30 pulse per channel per revolution.
- Customizable lead wires, cables, and or connectors.



Kit - Encoder with Target Magnet Shown with shaft pass through hole Wire color order varies with part configuration

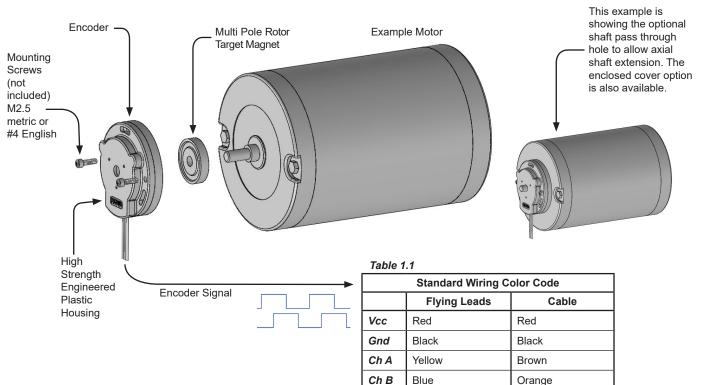


Other colors available upon request. Contact sales@phoenixamerica.com.

# **Application Example**

Tel: (888)-801-1422 Local: (260)-432-9664 Fax: (260)-432-9967

# **Output Waveforms**

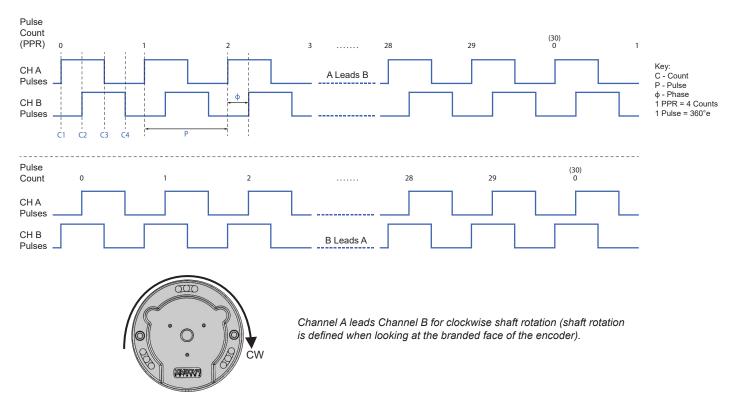

## **Absolute Maximum Ratings**

Table 2.2			
Characteristic	Symbol	Rating	Units
Forward Supply Voltage	V <sub>cc</sub>	32	V
Reverse Supply Voltage	V <sub>RCC</sub>	-0.3	V
Output Voltage	V <sub>OUT</sub>	32	V
Continuous Output Current	Ι <sub>ουτ</sub>	20	mA
Operating Temperature	T <sub>A</sub>	-40 - 125	°C
Storage Temperature	T <sub>s</sub>	-40 - 150	°C

## **Electrical Characteristics**

#### Table 2.3

Characteristic	Symbol	Test Conditions	Min.	Typ.¹	Max.	Unit <sup>2</sup>
Forward Supply Voltage	V <sub>cc</sub>	Operating, T <sub>J</sub> < 165 °C	4.0	-	24	V
Supply Current	I <sub>cc</sub>	V <sub>cc</sub> = 4 to 24V	1.4	3.0	5.6	mA
Output Current	I <sub>sink</sub>	V <sub>cc</sub> = 4 to 24V	-	-	15	mA
Output Frequency	f <sub>out</sub>	$V_{cc}$ = 4 to 24V	-	-	30	kHz


Higher output frequencies available upon request. Contact sales@phoenixamerica.com.

Phoenix America, INC 4717 Clubview Drive Fort Wayne, IN 46804 Tel: (888)-801-1422 Local: (260)-432-9664 Fax: (260)-432-9967 www.phoenixamerica.com sales@phoenixamerica.com © Copyright PAI 2017 Rev. 8/1/2017

Page 2


#### PHOENIX Δ М Е R IC

# **Electrical Circuit**

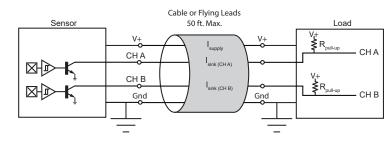

Output channels require customer supplied pull-up resistors unless internal pull-up option is selected. See Table 3.1 for recommended resistor values.



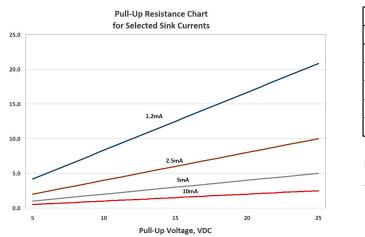

Recommended Pull-Up Resistor Values Supply Voltage Current, I 5 12 24 1.2 mA 4.3K 10.0K 20.0K 2.5 mA 4.7K 10.0K 2.0K 5 mA 1.0K 2.4K 4.7K 1.2K 10 mA 510Ω 2.4K

 ${\rm I}_{_{\rm sink}}$  is application dependent. It is recommended to use the lowest possible sink current when selecting a pull-up resistor.

Theoretical Pull-Up Resistor Calculation:  $R_{pullup} = \frac{supp}{I_{sink}}$ V<sub>supply</sub>


Resistance values based on closest standard 5% resistor values

Absolute Maximum I<sub>sink</sub> = 20mA

4.7 K pull-up is available as a standard option. If an alternative pull-up value is preferred, contact sales@phoenixamerica.com.

# Wiring

Pull-Up Resistance, KO

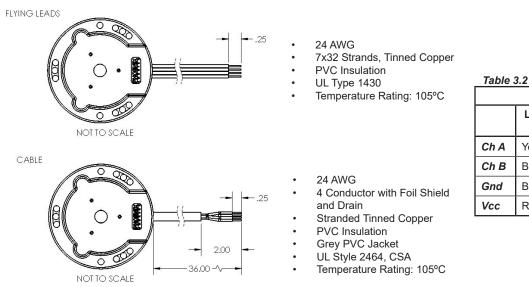

	Standard Wiring					
Leads Cable Connector Pin-Out						
Ch A	Yellow	Brown	1			
Ch B	Blue	Orange	2			
Gnd	Black	Black	3			
Vcc	Red	Red	4			


Custom lengths and insulation materials available. Contact sales@phoenixamerica.com.

**Phoenix America, INC** 4717 Clubview Drive Fort Wayne, IN 46804

Tel: (888)-801-1422 Local: (260)-432-9664 Fax: (260)-432-9967

www.phoenixamerica.com sales@phoenixamerica.com © Copyright PAI 2017 Rev. 8/1/2017

# **Encoder Physical Outline**

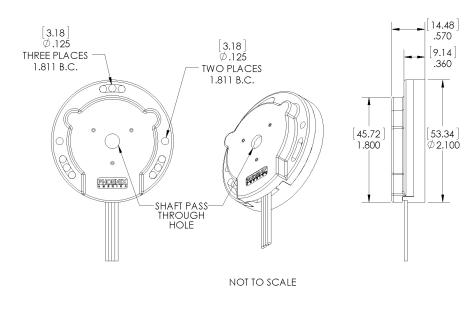

L9 Series	Magnetic Encoder
	Low Resolution Kit


Table 4.1				
Motor Shaft Diameter	Shaft Pass Through Hole Size (options/ recommendation)			
-	No I	Hole		
2 mm	2.06 mm	0.081 in		
3 mm	3.06 mm	0.120 in		
1/8 in	3.26 mm	0.127 in		
5/32 in	4.06 mm	0.160 in		
4 mm	4.06 mm	0.160 in		
3/16 in	4.83 mm	0.190 in		
5 mm	5.06 mm	0.199 in		
6 mm	6.06 mm	0.239 in		
1/4 in	6.40 mm	0.252 in		
7 mm	7.06 mm	0.278 in		
5/16 in	8.05 mm	0.317 in		
8 mm	8.05 mm	0.317 in		
3/8 in	9.59 mm	0.378 in		
10 mm	10.06 mm	0.396 in		
12 mm	12.06 mm	0.475 in		
1/2 in	12.76 mm	0.502 in		

Other shaft pass through hole sizes available upon request. Contact sales@phoenixamerica.com.

## **Encoder Mounting Guidelines**

Concentricity of the encoder housing to the magnet rotor is critical for optimal encoder performance. Considering the following during the design phase will ensure concentricity and ease of assembly.

- Tight molding tolerances allow for the outside diameter of the encoder to be used to locate the encoder housing concentric to the motor shaft and magnet rotor. A machined pocket on the motor endbell works well for alignment. Recommended pocket is 0.015" to 0.020" deep and 2.11" in diameter.
- Extending the shaft through the optional shaft pass through hole is an easy way to align the encoder housing to the motor shaft and magnet s rotor. Simply position the encoder so that the shaft is centered concentrically in the shaft pass through hole.
- If previous two methods of alignment are not used it is recommended that the encoder be fastened to the motor using #5-40 or M3 mounting screws. The slightly larger diameter of the #5-40 and M3 screws will compensate for some of the tolerance allowed when using the standard recommended #4-40 or M2.5 mounting screws.

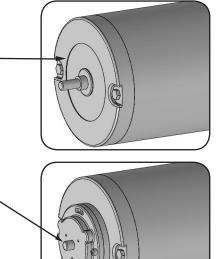

Page 4


Tel: (888)-801-1422 Local: (260)-432-9664 Fax: (260)-432-9967 www.phoenixamerica.com sales@phoenixamerica.com © Copyright PAI 2017 Rev. 8/1/2017

## Target Rotor Physical Outline - Molded (Mounting Style A)

PHOENIX

ERIC

A M

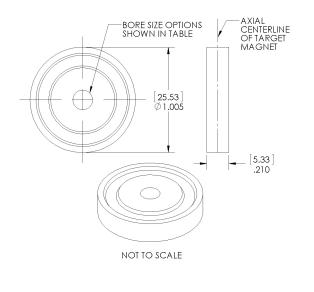

Bore Size (.inch)	Motor Shaft OD Size (nominal)	NEMA Guide Shaft Tolerance	Magnet Bore MIN. (inch)	Magnet Bore MAX. (inch)
079	2 mm (.0787")		.0777	.0807
118	3 mm (.1181")		.1171	.1201
125	1/8 in (.1250")		.1240	.1270
156	5/32 in (.1563")		.1553	.1583
157	4 mm (.1575")		.1565	.1595
188	3/16 in (.1875")		.1865	.1895
197	5 mm (.1969")		.1959	.1989
236	6 mm (.2364")	10 0000"/ 0 000E"	.2354	.2384
250	1/4 in (.2500")	+0.0000"/-0.0005"	.2490	.2520
276	7 mm (.2758")		.2747	.2777
313	5/16 in (.3125")		.3115	.3145
315	8 mm (.3150")		.3140	.3170
375	3/8 in (.3750")		.3740	.3770
394	10 mm (.3940")		.3930	.3960
473	12 mm (.4728")		.4718	.4748
500	1/2 in (.5000")		.4990	.5020


Other bore sizes available upon request. Contact sales@phoenixamerica.com.

## Target Rotor Mounting Guidelines - Molded (Mounting Style A) For Slip Fit Application

• Proper alignment of the target rotor to the encoder sensing element is critical for optimal encoder performance. Insure that the rotor is mounted to the specified height shown in the diagram below.

Table 5.1


- A machined step on the motor shaft provides a quick and repeatable method for positioning the target rotor. Spacers or other fixturing should be used to properly position the rotor if no mechanical locating features are on the shaft.
- Various adhesives can be used to bond the target rotor to the motor shaft. Shaft alloys, operating environment, and shaft speed and
  acceleration should be taken into consideration when selecting an appropriate bonding agent. Loctite threadlockers and retaining
  compounds have proved effective in bonding the target rotor to the motor shaft. Loctite 263 and 2760 threadlockers and Loctite 638 and
  680 retaining compounds are good candidates. These materials have been effective in past experience; testing under actual operating
  conditions should be used to qualify any bonding material.
- For best results, the motor shaft should be clean and free of any oils, lubricants, or solvents.
- Apply adhesive around the leading edge of the shaft and inside the hole in the rotor. Use a rotating motion when assembling the magnet to the shaft to insure good adhesive coverage.
- The use of primers and activators can be used to improve bond strength and cure rate.
- For non-critical applications or for fast bonding for evaluation, a cyanoacrylate adhesive (super glue) can be used. Loctite 401 and 410 have proven effective for quick bonding applications.

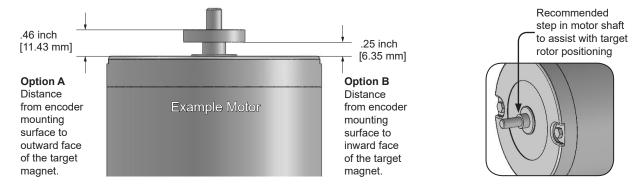

Phoenix America, INC 4717 Clubview Drive Fort Wayne, IN 46804 Tel: (888)-801-1422 Local: (260)-432-9664 Fax: (260)-432-9967 www.phoenixamerica.com sales@phoenixamerica.com © Copyright PAI 2017 Rev. 8/1/2017

Page 5

# Target Rotor Physical Outline - Aluminum Hub (Mounting Style B)

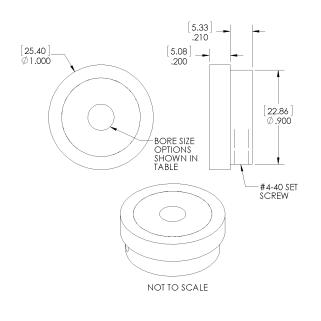

PHOEN

ERIC


A M

Table 6.1				
Bore Size (.inch)	Motor Shaft OD Size (nominal)	NEMA Guide Shaft Tolerance	Magnet Bore MIN. (inch)	Magnet Bore MAX. (inch)
079	2 mm (.0787")		.0794	.0803
118	3 mm (.1181")		.1188	.1197
125	1/8 in (.1250")		.1257	.1266
156	5/32 in (.1563")		.1570	.1579
157	4 mm (.1575")		.1582	.1591
188	3/16 in (.1875")	+0.0000"/-0.0005"	.1882	.1891
197	5 mm (.1969")		.1976	.1985
236	6 mm (.2364")		.2371	.2380
250	1/4 in (.2500")		.2507	.2516
276	7 mm (.2758")		.2767	.2778
313	5/16 in (.3125")		.3134	.3145
315	8 mm (.3150")		.3159	.3170
375	3/8 in (.3750")		.3759	.3770
394	10 mm (.3940")		.3949	.3960
473	12 mm (.4728")		.4737	.4748
500	1/2 in (.5000")		.5009	.5020

Other bore sizes available upon request. Contact sales@phoenixamerica.com.

## Target Rotor Mounting Guidelines - Aluminum Hub (Mounting Style B)


- Proper alignment of the target rotor to the encoder sensing element is critical for optimal encoder performance. Insure that the rotor is mounted to the specified height shown in the diagram below.
- A machined step on the motor shaft provides a quick and repeatable method for positioning the target rotor. Spacers or other fixturing should be used to properly position the rotor if no mechanical locating features are on the shaft.
- While the hub is held in the proper position, use a .50 inch hex wrench to tighten #4-40 set screw.
- For permanent applications, a threadlocker or retaining compound is advised in conjunction with the set screw.

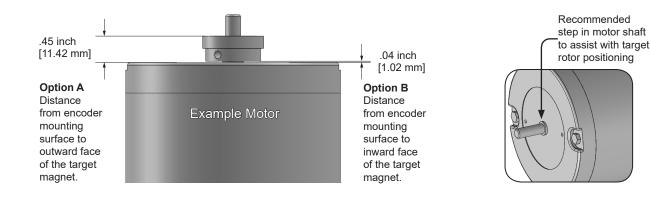

Tel: (888)-801-1422 Local: (260)-432-9664 Fax: (260)-432-9967 www.phoenixamerica.com sales@phoenixamerica.com © Copyright PAI 2017 Rev. 8/1/2017

Page 6

#### Target Rotor Physical Outline - Engineered Polymer Hub (Mounting Style H)

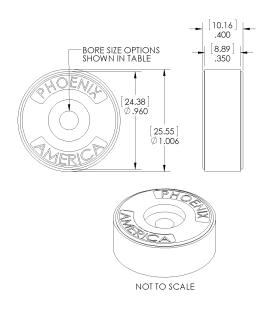

PHOENIX

ERIC

A M

Table 7.				
Bore Size (.inch)	Motor Shaft OD Size (nominal)	NEMA Guide Shaft Tolerance	Magnet Bore MIN. (inch)	Magnet Bore MAX. (inch)
079	2 mm (.0787")		.0727	.0757
118	3 mm (.1181")		.1121	.1151
125	1/8 in (.1250")		.1190	.1220
156	5/32 in (.1563")		.1503	.1533
157	4 mm (.1575")		.1515	.1545
188	3/16 in (.1875")	+0.0000"/-0.0005"	.1815	.1845
197	5 mm (.1969")		.1909	.1939
236	6 mm (.2364")		.2304	.2334
250	1/4 in (.2500")		.2440	.2470
276	7 mm (.2758")		.2698	.2728
313	5/16 in (.3125")		.3065	.3095
315	8 mm (.3150")		.3090	.3120
375	3/8 in (.3750")		.3690	.3720
394	10 mm (.3940")		.3880	.3910
473	12 mm (.4728")		.4668	.4698
500	1/2 in (.5000")		.4940	.4970


Other bore sizes available upon request. Contact sales@phoenixamerica.com.


## Target Rotor Mounting Guidelines - Engineered Polymer Hub (Mounting Style H) For Press Fit Application

Table 7 1

- Proper alignment of the target rotor to the encoder sensing element is critical for optimal encoder performance. Insure that the rotor is mounted to the specified height shown below.
- A machined step on the motor shaft provides a quick and repeatable method for positioning the target rotor. Spacers or other fixturing should be used if no mechanical locating features are on the shaft.
- A chamfered lead in on the shaft will aid in aligning the rotor.
- Prior to insertion, the motor shaft should be clean and free of any oils, lubricants, or solvents.
- Proper fixtures and support must be used to ensure the magnet is pressed on straight and aligned with the motor shaft.
- Opposite end of motor shaft should be supported to avoid undue stress on motor bearings during the pressing operation.
- In applications with high torque or environmental extremes, a retaining compound can be used to enhance the strength of the press fit.



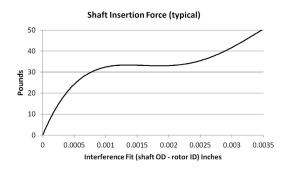


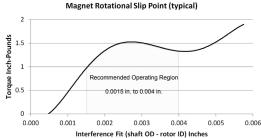


Page 7

Phoenix America, INC 4717 Clubview Drive Fort Wayne, IN 46804 Tel: (888)-801-1422 Local: (260)-432-9664 Fax: (260)-432-9967 www.phoenixamerica.com sales@phoenixamerica.com © Copyright PAI 2017 Rev. 8/1/2017

# **Connector Options**

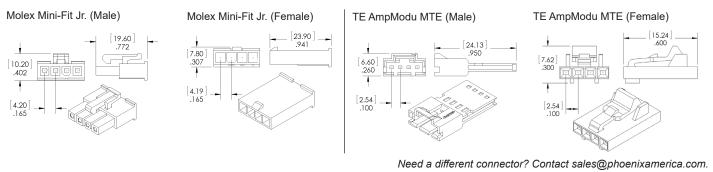

# **Part Number Description**

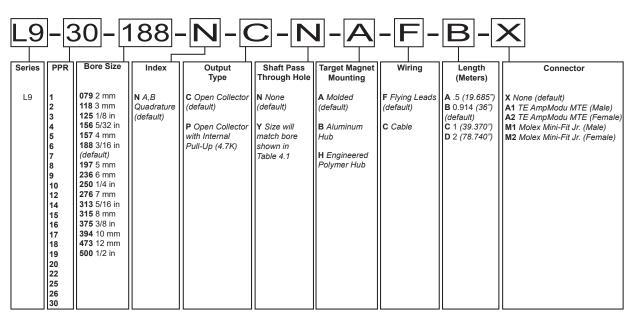

Example: L9-30-188-N-C-N-A-F-B-X